



In order to produce high-quality welds and achieve maximum productivity, it is essential to regularly check the condition of your consumables. By inspecting and replacing your consumables at the right time, you will not only maintain the performance and longevity of your torch, but also ensure that you achieve the best possible results and reliability every time you use it.

TORCH ASSEMBLY

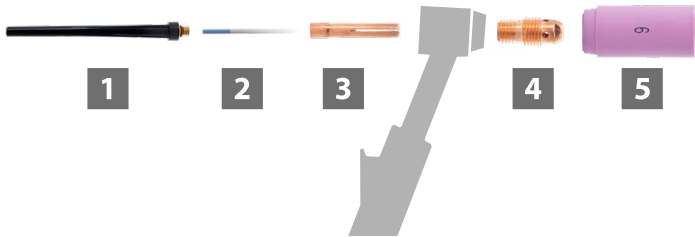

ELECTRODE SHARPENING

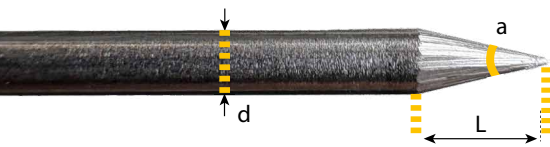

a = Angle adjustment: 15°, 30°, 45° or 60°
(The greater the angle, the wider the arc)
L = 3 x d for low current.
L = 1 x d for high current.

Ø Électrode (mm)	TIG DC		TIG AC
	Tungstène with oxides		Tungstène pure
1.6	60 > 150 A		45 > 90 A
2.0	100 > 200 A		65 > 125 A
2.4	170 > 250 A		80 > 140 A
3.2	225 > 330 A		150 > 190 A
4.0	350 > 480 A		180 > 260 A
	~ 80 A per mm of Ø		~ 60 A per mm of Ø

Tungsten electrode sharpener (Optional)
083721



KIT CONTENTS

